

DW16460D

PRESSURE SENSORS • CONNECTION G1/8" INNER THREAD

Pressure sensors are suitable for measuring different media with high accuracy. They are available with switching output and/or analog output. Using PC software, the measured values can be recorded depending on the device type. These sensors can be used in all areas of e.g. pneumatic and hydraulic applications.



MECHANICAL DATA

Ambient temperature	-10 °C ... 60 °C
Degree of protection (IP)	IP65
Explosion-proof	No
For gaseous media	Yes
Housing design	Cylinder plain
Housing material	Plastic ABS
Max. operating pressure	16000 hPa
Max. operating pressure	16 bar
Nominal pressure	10 bar
Sensing element material	Nickel-plated brass
Sensor diameter	16 mm
Sensor length	79 mm
Thread length	7 mm
Thread pitch	0.91 mm
Type of pressure connection	G1/8 inch A / M5 inside
With hand operation	No

ELECTRICAL DATA

Adjustable hysteresis	Yes
Adjustable unit	Yes
Electronic version	Yes
End setting (MAX)	10000 hPa
End value measuring range, pressure	1000000 Pa
Initial setting (MIN)	0 hPa
Initial value of measuring range, pressure	0 Pa
IO-Link compatible	Yes
Max. output current	250 mA
Measurement method	Relative
Measuring range pressure (MAX)	10 bar
No-load current	15 mA
Number of pins	4


ELECTRICAL DATA

Number of switching outputs	2
Operating voltage	10 V ... 30 V
Peak value memory	Yes
Rated operating voltage U _e at DC	10 V ... 30 V
Readiness delay	5000 ms
Relative linearity deviation	0.5 %
Relative repeat accuracy	0.2 %
Residual ripple	10 %
Response time	2.5 ms
Reverse polarity protection	Yes
Setting procedure	Parameterization
Short-circuit-proof	Yes
Suitable as 2-point control	Yes
Suitable as limiter	Yes
Suitable as monitor	Yes
Switching frequency	200 Hz
Switching output with window function	Yes
Temperature drift	3 %
Turn-off delay	99.9 s
Turn-on delay	99.9 s
Type of electrical connection	Plug-in connection M8
Type of switching function	Normally closed contact/normally open contact
Type of switching output	PNP
Voltage drop	2 V
Voltage type	DC
With display	Yes
With LED display	Yes
With manual on/off switch	No

OTHER DATA

For pneumatic applications	Yes
Measuring display	Relative

CONNECTION

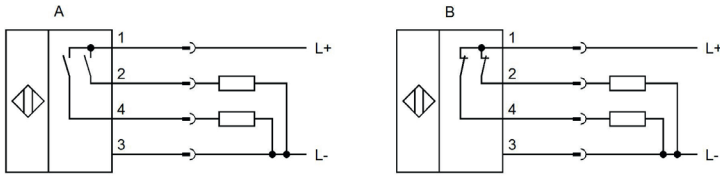


Colors: A: 1 = BN (brown), 2 = WH (white), 3 = BU (blue), 4 = BK (black)

B: 1 = BN (brown), 2 = WH (white), 3 = BU (blue), 4 = BK (black)
Functions: A: 1 = L+, 2 = PNP NO, 3 = L-, 4 = PNP NO

B: 1 = L+, 2 = PNP NC, 3 = L-, 4 = PNP NC

DIMENSIONAL DRAWING

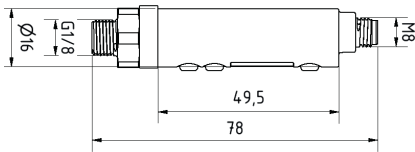

INSTALLATION



Mounting / Installation may only be carried out by a qualified electrician!

DISPOSAL



SAFETY WARNINGS

Before initial operation, please make sure to follow all safety instructions that may be provided in the product information!