


FK910100

FILLING LEVEL SENSORS • CAPACITIVE

Filling level and level sensors operate according to different measuring principles. The selection of the sensor depends on the medium to be detected and the ambient conditions. The material flow in a vibratory bowl can be excellently queried with inductive filling level sensors whose pendulum is moved by the material in the pot. The detection of liquid or solid media is, for instance, possible with capacitive filling level sensor technology. These work according to the principle of the condenser, the medium changes the dielectricity between two electrodes. The resulting change is converted into a digital output signal. A further alternative for the detection of filling levels of conductive media is provided by conductive filling level relays. The resistance between reference and measuring electrode is determined. If a set threshold is exceeded, a relay output switches.

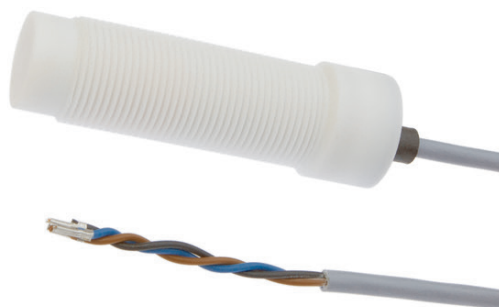

MECHANICAL DATA

Ambient temperature	-25 °C ... 75 °C
Cable length	2 m
Degree of protection (IP)	IP67
Housing design	Cylinder, screw-thread
Housing material	PTFE
Material of cable sheath	PVC
Medium temperature	-25 °C ... 75 °C
Number of wires	3
Probe diameter	26 mm
Probe length	10 mm
Sensing element material	PTFE
Sensor length	95 mm
Thread length	65 mm
Thread size, inches	3/4 inch
Type of process connection	G3/4 inch
Wire cross section	0.5 mm ²


ELECTRICAL DATA

Max. output current	0.4 A
No-load current	4 mA
Number of contacts as normally open contact	1
Physical measurement principle	Capacitive
Rated control supply voltage Us at DC	10 V ... 55 V
Response sensitivity, adjustable	Yes
Reverse polarity protection	Yes
Setting procedure	Manual adjustment
Short-circuit-proof	Yes
Switching frequency	10 Hz
Type of electrical connection	Cable

ELECTRICAL DATA

Type of switching function	Normally open contact
Type of switching output	PNP
Voltage drop	1 V
Voltage type for actuation	DC
With LED display	Yes


CONNECTION

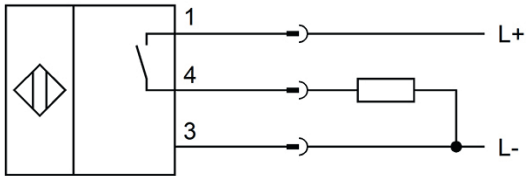

Colors: 1 = BN (brown), 3 = BU (blue), 4 = BK (black)

Functions: 1 = L+, 3 = L-, 4 = PNP NO

DIMENSIONAL DRAWING

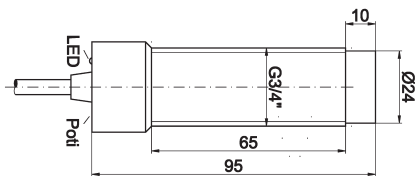

INSTALLATION



Mounting / Installation may only be carried out by a qualified electrician!

DISPOSAL



SAFETY WARNINGS

Before initial operation, please make sure to follow all safety instructions that may be provided in the product information!