

#### IA12012W

### INDUCTIVE SENSORS • ENLARGED AMBIENT TEMPERATURE

Inductive proximity switches are contact-free sensors. They detect all conductive metals, regardless of whether they move or not. The achievable sensing range of the devices depends on the object material and its dimensions. The vibration-resistant sensors can be approached laterally or frontally. Inductive proximity switches are used for presence detection (e.g. goods carriers), positioning (e.g. dampers), counting (e.g. nuts /bolts), speed detection (e.g. for cog wheels), on conveyor systems (e.g. hose feedings) or distance measurements (e.g. press-in checking) of metallic objects.



## **MECHANICAL DATA**

Active area material of sensor	PBT
Ambient temperature	-40 °C 100 °C
Ambient temperatures < -25°C	Yes
Degree of protection (IP)	IP67
Housing coating	Nickel-plated
Housing design	Cylinder, screw-thread
Housing material	Brass
Increased ambient temperatures > 80°C	Yes
Mechanical mounting condition for sensor	Flush
Pressure-proof	No
Sensor length	60 mm
Thread pitch	1 mm
Thread size, metric	12

# **ELECTRICAL DATA**


No
0.3
0.4
0.2
1
0.7
15 %
No
200 mA
15 mA
3
10 %
Yes
Yes
No
10 V 30 V



## **ELECTRICAL DATA**

Switching distance	2 mm
Switching frequency	1000 Hz
Type of electrical connection	Connector M12
Type of switching function	Normally open contact
Type of switching output	PNP
Voltage drop	2 V
Voltage type	DC
With LED display	Yes
With monitoring function of downstream devices	No


# **CONNECTION**

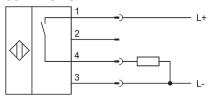

**Colors:** 1 = BN (brown), 2 = WH (white), 3 = BU (blue), 4 = BK (black)

**Functions:** 1 = L+, 2 = n. c., 3 = L-, 4 = PNP NO

## **DIMENSIONAL DRAWING**

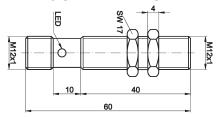

### **INSTALLATION**



Mounting / Installation may only be carried out by a qualified electrician!

### **DISPOSAL**



### **SAFETY WARNINGS**

Before initial operation, please make sure to follow all safety instructions that may be provided in the product information!