


UT180028

ULTRASONIC SENSORS • DISTANCE MEASUREMENT

Ultrasonic sensors are non-contact and wear-free position switches which can also be used under rough environmental conditions. A key advantage of these devices lies in the fact that the material and the surface characteristics of the objects to be detected can be almost anything. Solids, liquids, grainy materials and powdery materials can be identified without the shape or the color of the object having any influence to the measured result. In addition, the ability to detect transparent materials such as films and fluids is of particular importance. The shape and color of the objects do not influence the result of the detection. The capability to detect transparent films or liquids is also of special importance. Ultrasonic sensors are used for distance measurement (e.g. detection of diameters, loop control), for fill level detection (e.g. silo detection), for positioning and presence detection (e.g. glass pane positioning, film tear check, glass bottle detection)

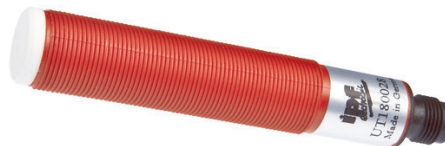

MECHANICAL DATA

Ambient temperature	-15 °C ... 70 °C
Degree of protection (IP)	IP67
Diameter detection	Yes
Housing design	Cylinder, screw-thread
Housing material	Plastic
Housing material, detail	Plastic
Sensor length	104 mm
Thread length	65 mm
Thread pitch	1 mm
Thread size, metric	18

ELECTRICAL DATA

Adjustable measuring range	Yes
Carrier frequency	180 kHz
Distance measuring sensors	Yes
Filling level measurement	Yes
Measuring range length	200 mm ... 1500 mm
No-load current	35 mA
Number of pins	4
Relative repeat accuracy	0.2 %
Response time	120 ms
Reverse polarity protection	Yes
Short-circuit-proof	Yes
Sound cone (angle of beam spread)	8 °
Sound outlet	Axial
Supply voltage	18 V ... 30 V
Synchronization input	Yes
Synchronization possible	Yes


ELECTRICAL DATA

Type of analog output	0 V ... 10 V
Type of electrical connection	Connector M12
Voltage type	DC

OTHER DATA

Level detection	Yes
Loop control	Yes
Relative linearity deviation	0.3 %


CONNECTION

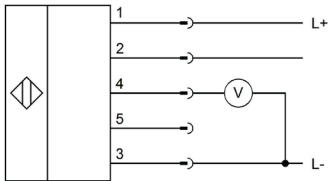

Colors: 1 = BN (brown), 2 = WH (white), 3 = BU (blue), 4 = BK (black)

Functions: 1 = L+, 2 = sync., 3 = L-, 4 = 0-10V

DIMENSIONAL DRAWING

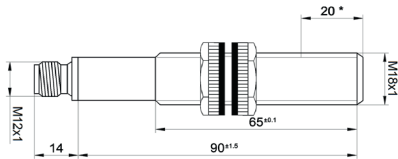

INSTALLATION



Mounting / Installation may only be carried out by a qualified electrician!

DISPOSAL



SAFETY WARNINGS

Before initial operation, please make sure to follow all safety instructions that may be provided in the product information!