

(€

Model Number

OMT300-R201-UEP-IO-0,3M-V1

Distance sensor with fixed cable and M12 connector, 4-pin

IO-Link

Features

- Medium design with versatile mounting options
- Space-saving distance sensors in small standardized design
- Multi Pixel Technology (MPT) exact and precise signal evaluation
- IO-link interface for service and process data
- Analog output 0 ... 10 V DC

Product information


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design-from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.


The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

Dimensions

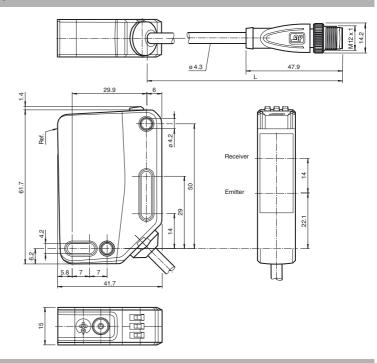


Electrical connection



Pinout

Wire colors in accordance with EN 60947-5-2 (brown) (white) WH BU BK (blue) (black)

Indicators/operating means



			0			
22	В		A)	В	Q	
G	⋖	<u></u>		⊳	_	

Q1B	Switching output/switch point B
Q1A	Switching output/switch point A
Q2A	Analog output/value A
Q2B	Analog output/value B
0	Keylock

Mode rotary switch

Operating indicator

Switching output display Q1

Teach-in button

2

3

ΥE

GN

Technical data					
General specifications					
Measurement range		100 300 mm			
· ·					
Reference target		standard white, 100 mm x 100 mm LED			
Light source Light type		modulated visible red light			
LED risk group labelling		exempt group			
Angle deviation		max. +/- 1.5 °			
Diameter of the light spot		approx. 8 mm at a distance of 300 mm			
Angle of divergence		1.8°			
Ambient light limit		EN 60947-5-2 : 45000 Lux			
Resolution		0.1 mm			
Functional safety related parame	atore	2.1.			
MTTF _d	, icis	520 a			
Mission Time (T _M)		20 a			
Diagnostic Coverage (DC)		0%			
- · · ·		0 /0			
Indicators/operating means		LED green:			
Operation indicator		constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode			
Function indicator		LED yellow: constantly on - switch output active constantly off - switch output inactive			
Control elements		Teach-In key			
Control elements		5-step rotary switch for operating modes selection			
Electrical specifications					
Operating voltage	U_B	18 30 V DC			
Ripple		max. 10 %			
No-load supply current	I ₀	< 25 mA at 24 V supply voltage			
Protection class		III			
Interface					
Interface type		IO-Link (via C/Q = pin 4)			
Device profile		Identification and diagnosis			
		Smart Sensor type 0/type 3.3			
Transfer rate		COM 2 (38.4 kBaud)			
IO-Link Revision		1.1			
Min. cycle time		3 ms			
Process data witdh		Process data input 4 byte Process data output 2 bits			
SIO mode support		yes			
Device ID		0x111916 (1120534)			
Compatible master port type		A			
Output					
Switching type		The default setting is: C/Q - Pin4: NPN normally open, PNP normally closed, IO-Link U—Pin2: analog output 0 10 V			
Signal output Switching voltage		1 push-pull output , 1 analog output , short-circuit-proof, reverse polarity protection, surge-proof			
Switching voltage Switching current		max 100 mA reciptive lead			
Usage category		max. 100 mA , resistive load DC-12 and DC-13			
Voltage drop	Ud	≤ 1.5 V DC			
Response time	ď	2 ms , see table 1			
Analog output					
Output type		1 voltage output: 0 10 V			
Load resistor		> 1 k Ω voltage output; \leq 470 Ω current output			
Recovery time		2 ms			
Conformity					
Communication interface		IEC 61131-9			
Product standard		EN 60947-5-2			
Measurement accuracy					
Temperature drift		0.05 %/K			
Warm up time		5 min			
Repeat accuracy		< 0.5 %, see table 1			
Linearity error		0.5 %			
Ambient conditions					
Ambient temperature		10 50 °C (50 122 °F)			
Storage temperature		-40 70 °C (-40 158 °F)			
Mechanical specifications					
Housing width		15 mm			
Housing wath		15 mm			
Housing neight Housing depth		61.7 mm 41.7 mm			
Degree of protection		41.7 mm IP67 / IP69 / IP69K			
Connection		300 mm fixed cable with M12 x 1, 4-pin connector			
Material		300 Hill lixed dubic with WHZ X 1, 4-pin confidence			

Accessories

V1-G-2M-PUR

Female cordset, M12, 4-pin, PUR cable

V1-W-2M-PUR

Female cordset, M12, 4-pin, PUR cable

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

Other suitable accessories can be found at www.pepperl-fuchs.com



FPEPPERL+FUCHS

Housing	PC (Polycarbonate)	
Optical face	PMMA	
Mass	approx. 55 g	
Cable length	0.3 m	

Approvals and certificates

UL approval E87056 , cULus Listed , class 2 power supply , type rating 1
CCC approval CCC approval / marking not required for products rated ≤36 V

Table 1: Information on Measured Value Filters

Measured value filter						
Filter	1-way	2-way	4-way	16-way	64-way	256-way
Response time (ms)	2	4	8	32	128	512
Repeatability (%)		< 0.5 %				

Settings

Teach-In (TI)

Use the rotary switch for switching signal Q1 to select the relevant switching threshold A and/or B to teach in.

· The yellow LEDs indicate the current state of the selected output.


To teach in a switching threshold, press and hold the "TI" button for approximately 1 s, until the yellow and green LEDs flash in phase. Teach-in starts when the "TI" button is released.

- Teach-in successful: the yellow and green LEDs flash alternately at 2.5 Hz.
- Teach-in unsuccessful: the yellow and green LEDs quickly flash alternately at 8 Hz.


After an unsuccessful Teach-in, the sensor continues to operate with the previous valid setting after the relevant visual fault signal is issued.

Set switching mode: you can define different switching modes by teaching in the relevant distance data for switching thresholds A and B.

1. Single point mode:



2. Window mode:



Teach in switching thresholds: you can teach in or overwrite a taught-in switching threshold at any time. To do this, press the "TI" button again.

Reset a value: you can reset a taught-in value. To do this, press the "TI" button for > 4 s, until the yellow and green LEDs go out. The reset process itself starts when the "TI" button is released.

· Reset successful: the yellow and green LEDs flash alternately at 2.5 Hz.

Minimum and maximum values for the analog output Q2 are taught in and deleted in the same way as those for the switching output. The following applies:

A = Minimum voltage/current

B = Maximum voltage/current

Resetting to Factory Settings

To revert back to factory settings, press the "TI" button for > 10 s with the rotary switch set to position "O," until the yellow and green LEDs go out at the same time. The reset process itself starts when the "TI" button is released.

 Reset to factory settings successful: the yellow and green LEDs light up at the same time. The sensor then continues to operate with factory settings.

OMT-IEP

295670-100282_eng.xml

2019-02-11

issue:

Date of

2019-02-11 11:04

date:

- Factory setting for switching signal Q1:
 Switching signal is high active, window mode
- Analog output: current output, 4 mA ... 20 mA absolute mode

OMT-UEP

- Factory setting for switching signal Q1: Switching signal is high active, window mode
- · Analog output: voltage output, 0 V ... 10 V absolute mode

Analog output

The analog output type can be configured as voltage or current output via IO-Link. The following output types are available:

- Analog output 0 mA ...20 mA
- Analog output 4 mA ...20 mA
- Analog output 0 V ...10 V

The following operating modes are available:


- · Absolute mode (default setting)
- · Normalized mode
- · Rising slope
- · Falling slope

The following substitute values can optionally be configured:


- No substitute values used (default setting)
- · Substitute value for "no measured value" used
- Substitute value for "no measured value" and "Measuring overrange" used

The sensor's tolerances are based on the digital process data.


Absolute mode (default setting, A and B = deleted)

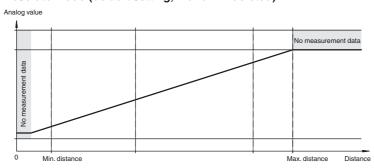


Normal mode (A and B without teach-in / deleted)

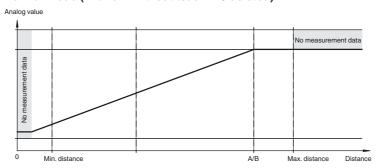

Rising slope (A < B)

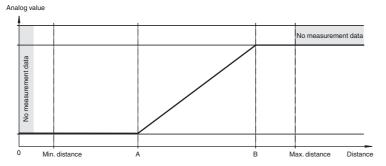

Falling slope (A > B)

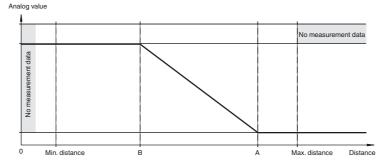

Configuration via IO-Link interface

Setting different operating modes via the IO-Link interface

The devices are equipped with an IO-Link interface as standard for diagnostics and parameterization tasks to ensure optimum adjustment of the sensors to the relevant application.

Single point mode operating mode (one switch point):

- "Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.
- "The switch point corresponds exactly to the set point.




Window mode operating mode (two switch points):

- · Detection of objects irrespective of type and color in a defined detection range. Reliable detection when object leaves the detection range.
- · Window mode with two switch points.




Center window mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Sets a defined window around a given object. Objects outside
 this window are not detected.
- · Window mode with one switch point.



Two point mode operating mode (hysteresis operating mode):

• Detection of objects irrespective of type and color between a defined switch-on and switch-off point.



Inactive operating mode:

• Evaluation of switching signals is deactivated.

The associated IODD device description file can be found in the download area at www.pepperl-fuchs.com.