

CE

Model Number

DK20/35B/79B

Print mark contrast sensor with 5-pin, M12 x 1 connector

Features

- Diffuse mode sensor for recording any • print mark
- Static TEACH-IN: automatic switching ٠ threshold adaptation
- Optical system exchangeable by 90° .
- 30 us response time, suitable for ex-• tremely rapid scanning processes
- Red transmission light

Product information

The contrast sensor series DK10, DK2X, DKE2X and DK3X have an extreme robust and IP67 tight industrial standard housing with eight M5 metal reinforced inserts for sensor mounting. The lenses are made of high grade glass. All sensors offer different light spot shapes and orientations and have powerful push-pull outputs (NPN/PNP/pushpull).


The DK10 sensor series offers laser and LED light sources, a manual sensitivity adjustment and high sensing ranges up to 800 mm.

The DK20/DK21/DKE2X standard contrast sensor series offers a very good contrast recognition and are available in extreme robust stainless-steel housings (DKE).

The DK31/DK34/DK35 sensor series is designed for cutting edge contrast recognition at highest sensitivity level.


The series DK20/DK34 offer a static Teach-In, the DK21/DKE21/DK31/DK35 series offer a dynamic Teach-In.



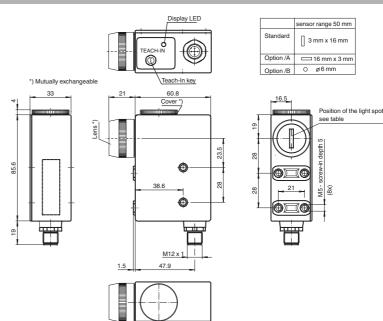

19

Electrical connection

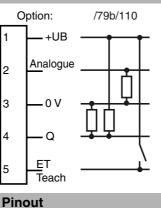



Pepperl+Fuchs Group

www.pepperl-fuchs.com

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



Technical data			Accessories	
General specifications			V15-G-5M-PVC	
Sensor range		50 mm	Female cordset, M12, 5-pin, PVC cable	
Light source		LED		
Light type		modulated visible red light	V15-W-5M-PVC	
Light spot representation		3 mm x 16 mm , light spot parallel to housing	Female cordset, M12, 5-pin, PVC cable	
Angle deviation		max. ± 3°	· · · ·	
Ambient light limit		OMH-DK		
Continuous light		7000 Lux	Right-Angled Mounting Bracket	
Teach-In		static Teach-In	OMH-DK-1	
Functional safety related parameters				
MTTF _d		650 a	Flat Mounting Bracket	
Mission Time (T _M)		20 a	Other suitable accessories can be found at	
Diagnostic Coverage (DC)		0 %	www.pepperl-fuchs.com	
Indicators/operating means				
Function indicator		LED yellow; switching operation: lights up if print mark is detec- ted Teach-In operation: flashing slowly alarm display: flashing quickly, if no safe operation is possible		
Control elements		Teach-In key		
Electrical specifications				
Operating voltage	UB	10 30 V DC		
Ripple		10 %		
No-load supply current	I ₀	≤ 70 mA		
Input				
Function input		Teach-In input		
Output				
Switching type		light/dark on switchable, results from the order of the Teach-In		
Signal output		Push-pull output, short-circuit protected, reverse polarity protec- ted		
Switching voltage		$PNP: \ge (+U_B - 2.5 V)$, $NPN: \le 1.5 V$		
Switching current		max. 200 mA		
Measurement output		Analog output 0.3 10 mA, (RL \leq 600 Ohm)		
Switching frequency	f	16.5 kHz		
Response time		30 µs		
Ambient conditions				
Ambient temperature		-20 60 °C (-4 140 °F)		
Storage temperature		-20 75 °C (-4 167 °F)		
Mechanical specifications				
Protection degree		IP67		
Connection		M12 x 1 connector, 5-pin		
Material				
Housing		PC (glass-fiber-reinforced Makrolon)		
Optical face		glass		
Mass		200 g		
Compliance with standards ar ves	nd direct	-		
Standard conformity				
Product standard		EN 60947-5-2:2007 IEC 60947-5-2:2007		
Shock and impact resistance		IEC / EN 60068. half-sine, 40 g in each X, Y and Z directions		
Vibration resistance		IEC / EN 60068-2-6. Sinus. 10 -150 Hz, 5 g in each X, Y and Z directions		
Approvals and certificates				
		cULus Listed, Class 2 power source		
UL approval		colus listed, blass 2 power source		

Construction

This device is supplied with a changeable Lens. By interchanging Lens and cover the sensor is able to be modified from a side-looker to a top-looker and vice versa.

Adjustment

www.pepperl-fuchs.com

2

- 1. Point the light spot to the print mark. With mirroring or shiny object surface the sensor has to be tilt by 10° ... 15°.
- 2. Press Teach-In key at the device or apply a positive pulse (UB+) for at least 50 ms to the external Teach-In input.

After finishing this first step, the indicator LED flashes slowly (approx. 1 Hz).

- 3. Point light spot to the underground/background.
- 4. Press Teach-In key or apply Teach-In signal once more.



- 5. If Teach-In successful: sensor in switching mod, LED off. Alarme-Function: insufficient contrast. No reliable switching operation possible. Indicator LED flashes fast (approx. 4 Hz)
- 6. Return to switching mode when pressing key

The switching signal level is set automatically to the middle between print mark and background. For exact contrast evaluation the DK..., as an option, can be delivered with an additional analogue output.

